REQUEST FOR AGENDA PLACEMEN Submission Deadline - Tuesday, 12:00 PM before C	
SUBMITTED BY: Sheriff Adam King TODAY'S DATE: October 24, 2018	
DEPARTMENT: Sheriff/560  SIGNATURE OF DEPARTMENT HEAD:	um King
REQUESTED AGENDA DATE: November 13, 201	8
SPECIFIC AGENDA WORDING:	
Consideration to pay Lonestar Collision for damage on vehi reimbursed by the insurance company.	cle prior to being
\$10,815.60 (includes deductible) amount to be reimbursed b	y TAC is \$9,815.60
PERSON(S) TO PRESENT ITEM: Sheriff Adam King or b	his designee
SUPPORT MATERIAL: (Must enclose supporting documents)	mentation)
TIME: 5 minutes ACTION 1	ITEM: X
WORKSH	IOP
(Anticipated number of minutes needed to discuss item) CONSEN	Γ:
EXECUTI	IVE:
STAFF NOTICE:	
COUNTY ATTORNEY: X IT DEPARTMENT:	
AUDITOR:X PURCHASING DEP	ARTMENT:X
PERSONNEL: PUBLIC WORKS:	
BUDGET COORDINATOR: OTHER:	
*********This Section to be Completed by County Judge's	s Office*******
ASSIGNED AGENDA DATE:	
REQUEST RECEIVED BY COUNTY JUDGE'S OFFICE	· .
COURT MEMBER APPROVAL	Date

# LONESTAR COLLISION

Workfile ID:

d0f3f262

101 MAXIE STREET, CLEBURNE, TX 76033

Phone: (817) 558-4949 FAX: (817) 556-0919

#### **Final Bill**

**RO Number: 56550** 

Customer:

Insurance:

**ATLANTA** 

Adjuster:

ASHLEE MARSHALL

Estimator:

Leo Gonzalez

County, Johnson

ASSURANCE AMERICA

Phone:

(888) 580-8134 x6326 Business

Create Date:

8/14/2018

1102 E Kilpatrick

Cleburne, TX 76031

Claim:

1TX258409-2

Loss Date:

8/2/2018

(817) 556-6049

Deductible:

2016 FORD Explorer Utility Police Interceptor AWD (Fleet) 4D UTV 6-3.7L Gasoline Sequential MPI WHITE

VIN:

1FM5K8AR6GGC14905

Interior Color:

BLACK

Mileage In:

71,825

Vehicle Out:

2.0 Body

10/26/2018

License:

1319730

Exterior Color:

**FRONT DOOR** 

LT Outer panel

Add for Clear Coat

Overlap Major Non-Adj. Panel

WHITE

Mileage Out:

State:			Production Date: 1/2016		Condition:		Job #:		
Line	Ver	Operation	Description	Qty	Extended Price \$	Part Type	Labor	Туре	Paint
1	S01	Repair	FLOOR SET UP				0.5	Body	
2	S01	Repair	PULL INNER PANEL AND LOWER FLOOR EXT				2.0	Body	
3	E01	Repair	REMOVE LT FRT DOOR GRAPHIC				4.0	Body	
4	E01	Remove/Replace	FRT BUMPER PUSH GUARD	1	499.00T	A/M	2.0	Body	
5	S05	Sublet	REPLACE LT FRT DOOR GRAPHIC	1	350.00	Sublet			
6	S05	Repair	RE-PROGRAM BODY CONTROL MODULE				3.0	Mech	
7	S05	Repair	RE-WIRE FRT STROBE LIGHTS INTO NEW PUSH GUARD				2.0	Mech	
8	E01		FRONT BUMPER						
9	E01	Repair	Bumper cover w/o park sensor, w/o tow hook w/o auto park, w/o camera				2.0	Body	2.4
10	E01		Add for Clear Coat						1.0
11	E01	Remove/Replace	Valance	1	170.00T	A/M	0.3	Body	
12	E01	Remove/Replace	Lower grille	1	109.65T	OEM	0.2	Body	
13	S03	Remove/Replace	Lower molding	1	167.00T	A/M	0.3	Body	
14	E01		GRILLE						
15	E01	Remove/Replace	Grille POLICE INTERCEPTOR	1	452.38T	OEM	0.4	Body	
16	E01		FRONT LAMPS						
17	E01	Remove/Install	RT R&I headlamp assy				0.3	Body	
18	E01	Remove/Install	LT R&I headlamp assy				0.3	Body	

19

20

21

22

E01

E01

E01

E01

Repair

2.4

(0.2)

0.4

T = Taxable Item, RPD = Related Prior Damage, AA = Appearance Allowance, UPD = Unrelated Prior Damage, PDR = Paintless Dent Repair, A/M = Aftermarket, Rechr = Rechromed, Reman = Remanufactured, OEM = New Original Equipment Manufacturer, Recor = Re-cored, RECOND = Reconditioned, LKQ = Like Kind Quality or Used, Diag = Diagnostic, Elec = Electrical, Mech = Mechanical, Ref = Refinish, Struc = Structural

## **RC Number: 56550**

2016 FORD Explorer Utility Police Interceptor AWD (Fleet) 4D UTV 6-3.7L Gasoline Sequential MPI WHITE

23	E01	Remove/Install	LT Belt w'strip				0.3	Body	
24	S01	Remove/Replace	LT Lower molding absolute black	1	241.30T	OEM		Body	0.5
25	S01	, ,	Overlap Minor Panel					•	(0.2)
26	S01		Add for Clear Coat						0.1
27	E01	Remove/Install	LT Mirror outside power, w/o power fold w/o lamps				0.3	Body	
28	E01	Remove/Install	LT Run channel				0.3	Body	
29	E01	Remove/Install	LT Handle, outside black				0.4	Body	
30	E01	Remove/Install	LT R&I trim panel				0.5	Body	
31	E01		QUARTER PANEL						
32	E01	Remove/Replace	LT quarter panel	1	450.00T	Used	17.0	Body	3.5
33	E01		Overlap Major Non-Adj. Panel						(0.2)
34	E01		Add for Clear Coat						0.7
35	E01	Repair	CUT AND TRIM LKQ PART				4.0	Body	
36	E01	Remove/Replace	LT Vent grille	1	20.35T	OEM	0.1	Body	
37	E01	Remove/Replace	LT Wheel opng mldg	1	105.75T	OEM	0.4	Body	
38	E01	Remove/Install	LT Upper molding				0.3	Body	
39	E01	Remove/Install	LT Qtr glass FORD green tint				1.6	Body	
40	S01	Repair	LT Inner wheelhouse				5.0	Body	0.7
41	E01	Repair	LT Inner panel (HSS)				2.0	Body	1.5
42	E01		Add for Clear Coat						0.3
43	E01	Remove/Install	LT Qtr trim panel w/o inflatable 2nd row seat belts w/6 speaker audio-ebony				0.5	Body	
44	E01	Remove/Install	LT Rear pillar trim w/o 12 speaker audio ebony				0.2	Body	
45	E01	Remove/Install	BACK SEAT AND BACK PANEL				1.0	Body	
46	E01		REAR BODY & FLOOR						
47	E01	Repair	LT Floor extn				2.0	Body	0.5
48	S01		Overlap Minor Panel						(0.2)
49	E01		REAR SUSPENSION						
50	S04	Remove/Replace	O/H rr susp It				3.9	Mech	
51	S04	Remove/Replace	LT Hub	1	185.98T	OEM	0.0	Mech	
52	E01	Remove/Replace	LT Stabilizer link	1	50.69T	OEM	0.4	Mech	
53	S04	Remove/Replace	LT Knuckle	1	479.80T	OEM	0.0	Mech	
54	S04	Remove/Replace	Deduct for Overlap				(0.2)	Mech	
55	S04	Remove/Replace	LT Lower cntrl arm	1	258.07T	OEM	0.0	Mech	
56	S04	Remove/Replace	LT Upper cntrl arm	1	184.05T	OEM	0.8	Mech	
57	S04	Remove/Replace	Deduct for Overlap				(0.4)	Mech	
58	S04	Remove/Replace	LT Lateral arm 3.7 liter	1	45.33T	QEM	0.0	Mech	
59	S04	Remove/Replace	LT Trailing arm	1	93.36T	OEM	0.0	Mech	
60	<b>S</b> 04	Remove/Replace	LT Mount bushing	1	45.00T	OEM			
61	S04	Remove/Replace	LT Shock 3.7 liter	1	74.04T	OEM	0.0	Mech	
62	E01		REAR LAMPS						

T = Taxable Item, RPD = Related Prior Damage, AA = Appearance Allowance, UPD = Unrelated Prior Damage, PDR = Paintless Dent Repair, A/M = Aftermarket, Rechr = Rechromed, Reman = Remanufactured, OEM = New Original Equipment Manufacturer, Recor = Re-cored, RECOND = Reconditioned, LKQ = Like Kind Quality or Used, Diag = Diagnostic, Elec = Electrical, Mech = Mechanical, Ref = Refinish, Struc = Structural

## **RO Number: 56550**

2016 FORD Explorer Utility Police Interceptor AWD (Fleet) 4D UTV 6-3.7L Gasoline Sequential MPI WHITE

63	E01	Remove/Install	LT Tail lamp assy level 1				0.3	Body	
64	E01		REAR BUMPER						
65	E01	Remove/Replace	O/H rear bumper				1.8	Body	
66	E01	Remove/Replace	Bumper cover w/o park sensors	1	366.00T	A/M	0.0	Body	2.4
67	E01		Overlap Major Non-Adj. Panel						(0.2)
68	E01		Add for Clear Coat						0.4
69	E01	Remove/Replace	Deduct for Rear Bumper R&I				(1.2)	Body	
70	E01	Remove/Replace	Lower cover w/o auto park	1	342.27T	OEM	0.0	Body	
71	E01	Remove/Replace	LT Side bracket	1	35.47T	OEM	0.1	Body	
72	E01	Remove/Replace	LT Side support	1	22.22T	OEM	0.1	Body	
73	S02	Remove/Replace	Valance	1	148.00T	A/M	0.3	Body	
74	S02	Remove/Replace	Absorber	. 1	135.00T	A/M	0.1	Body	
75	E01		WHEELS						
76	E01	Remove/Install	LT/Front R&I wheel				0.1	Body	
77	E01	Remove/Install	LT/Rear R&I wheel				0.1	Body	
78	E01	Sublet	WHEEL REPAIR	1	137.50	Other			
79	E01	Sublet	WHEEL REPAIR	1	137.50	Other			
80	E01	Remove/Replace	LT RR TIRE	1	429.00	Other			
81	E01	Sublet	4 WHEEL ALIGNMENT	. 1	89.99	Other			

Estimate Totals	Discount \$	Markup \$	Rate \$	Total Hours	Total \$
Parts		344.50			5,454.21
Sublet/Miscellaneous		87.50			802.49
Labor, Body			46.00	52.3	2,405.80
Labor, Refinish			46.00	15.8	726.80
Labor, Mechanical			85.00	9.5	807.50
Material, Paint					568.80
Towing					50.00
Subtotal					10,815.60
Sales Tax					0.00
Grand Total					10,815.60
Net Total					10,815.60

Estimate Version	Total \$
Original	8,065.88
Supplement S01	548.20
Supplement S02	324.74
Supplement S03	.194.58
Supplement S04	1,242.36
Supplement S05	892.50
Supplement S06	(452.66)

10/22/2018 11:19:08 AM

T = Taxable Item, RPD = Related Prior Damage, AA = Appearance Allowance, UPD = Unrelated Prior Damage, PDR = Paintless Dent Repair, A/M = Aftermarket, Rechr = Rechromed, Reman = Remanufactured, OEM = New Original Equipment Manufacturer, Recor = Re-cored, RECOND = Reconditioned, LKQ = Like Kind Quality or Used, Diag = Diagnostic, Elec = Electrical, Mech = Mechanical, Ref = Refinish, Struc = Structural

## **Final Bill**

## **RO Number: 56550**

2016 FORD Explorer Utility Police Interceptor AWD (Fleet) 4D UTV 6-3.7L Gasoline Sequential MPI WHITE

Insurance Total \$:	10,815.60
Received from Insurance \$:	0.00
Balance due from Insurance \$:	10,815.60
Customer Total \$:	0.00
Received from Customer \$:	0.00
Balance due from Customer \$:	0.00

T = Taxable Item, RPD = Related Prior Damage, AA = Appearance Allowance, UPD = Unrelated Prior Damage, PDR = Paintless Dent Repair, A/M = Aftermarket, Rechr = Rechromed, Reman = Remanufactured, OEM = New Original Equipment Manufacturer, Recor = Re-cored, RECOND = Reconditioned, LKQ = Like Kind Quality or Used, Diag = Diagnostic, Elec = Electrical, Mech = Mechanical, Ref = Refinish, Struc = Structural

Date: 10/22/2018 09:04 AM Estimate ID: 9458100019

Estimate Version: 0

Committed

Profile ID: \* PDA TX Quote ID: 37757569

# **PDA Sherman**

P O Box 2403, Sherman, TX 75091 (903) 891-9181 Fax: (903) 891-9187 Email: pdasherman@pdaorg.net

\*Not An Authorization For repair\* Read disclaimers following appraisal calculations.

Damage Assessed By: Phillip Griffin

Appraised For: Joe Copeland Texas Association of Counties

Type of Loss: Collision

Date Assigned. 10/16/2018

(512) 615-8910

Classification: Field

Condition Code: Good

Date of Loss: 8/2/2018 10/16/2018

Contact Date: Deductible: 0.00

File Number: 9458100019 Clalm Number: APD20185193-1

> Insured: Johnson County Owner:

Johnson County Address: 1102 E Klipatrick, Cleburne, TX 76031

Cell Phone:

Telephone:

(817) 556-6049

Mitchell Service: 911800

Description: 2016 Ford Explorer Police Intercepto

Body Style: 4D Ut

Vehicle Production Date: 1/16

VIN: 1FM5K8AR6GGC14905

Drive Train: 3.7L inj 6 Cyl AWD License: 1319730 TX

Mileage: 71,825

OEM/ALT:

Search Code: 945

Color: White Options:

PASSENGER AIRBAG, POWER DRIVER SEAT, POWER LOCK, POWER WINDOW, POWER STEERING

POWER BRAKE, REAR WINDOW DEFOGGER, CRUISE CONTROL, TILT STEERING COLUMN FM RADIO, ANTI-LOCK BRAKE SYS., TIRE INFLATION/PRESSURE MONITOR, 4WD OR AWD

Days to Repair: 12

Line	•			Line Item	Part Type/	Dollar		Labor	
ltem	Number	Туре	Operation	Description	Part Number	Amount	Į	Units	
1	900500	FRM *	REPAIR	Floor Frame Repair Set Up	Existing			0.5*	
2	100731	BDY	REPAIR	Frt Bumper Cover	Existing			2.0*#	¥
3		REF	REFINISH/REPAIR	Frt Bumper Cover	_	1	Ç	2.4*	
4				MODIFIED REFINISH WITH FULL CLEAR COAT					
5	100737	BDY	REMOVE/REPLACE	Frt Ctr Bumper Grille	FB5Z 17K945 AA	109.65		0.3 #	¥.
6	100711	BDY	REMOVE/REPLACE	Frt Ctr Bumper Moulding	** QUAL REPL PART	167.00		0.4 #	#
7	AUTO	REF	REFINISH	Frt Ctr Bumper Moulding		1	C	1.2	
8	100714	BDY	REMOVE/REPLACE	Frt Lwr Bumper Valance Panel	** QUAL REPL PART	170.00	*	0.5 #	¥
9	900500	BDY *	REMOVE/REPLACE	Go Industries Front Bumper Guard	** QUAL REPL PART	526,51	*	2.0*	
10	100740	BDY	REMOVE/REPLACE	Grille Assembly	FB5Z 8200 GB	452.38		0.4 #	#
11	101503	BDY	REMOVE/INSTALL	R Front Combination Lamp				0.3 #	#
12	101504	BDY	REMOVE/INSTALL	L Front Combination Lamp				0.3 #	#
13	101432	BDY	REMOVE/INSTALL	Wheel	Existing			0.3	r
14	101432	BDY	REMOVE/REPLACE	Wheel 2@93.75	Remanufactured	187.50	*	0.6	
15	931119	BDY	REMOVE/REPLACE	Left Rear Tire	** QUAL REPL PART	530.94	*	INC*	
16				245-55R18 Firestone Pursuit					
17	900500	BDY *	REPAIR	Tire Disposal Fee	Sublet	3.75	k	0.0*	
ES'	TIMATE RI	ECALL N	UMBER: 10/22/2018 09:	04:15 9458100019					
Mit	chell Data	Version:	OEM: OCT_18_V						
			MAPP:OCT_18_V	Copyright (C) 1994 - 2018 Mitchell International		Page	1	of	5
Sof	tware Vers	sion:	7.1.232	All Rights Reserved					

Date: 10/22/2018 09:04 AM Estimate ID: 9458100019

Estimate Version: 0

Committed
Profile ID: \*PDA TX
Quote ID: 37757569

						757569
18	931125	BDY	REMOYE/REPLACE	Mount & Balance Tire	Sublet	18.00 * 0.0*
19	931105	MCH	ADD'L LABOR OP	Four Wheel Alignment	Sublet	89.99 * 0.0*
20	101477	BDY	REMOVE/INSTALL	R Rear Seat Assy		0.3
21	101478	BDY	REMOVE/INSTALL	L Rear Seat Assy		INC
22	900500	BDY *	REMOVE/INSTALL	Seat Divider	Existing	0.3* r
23	101040	BDY	REPAIR	L Frt Door Shell	Existing	2.0*#
24	AUTO	REF	REFINISH	L Frt Door Outside		C 2.3
25	100181	BDY	REMOVE/INSTALL	L Frt Otr Door Belt Moulding		0.3
26	100183	BDY	REMOVE/INSTALL	L Frt Rear View Mirror		0.3
27	100185	BDY	REMOVE/INSTALL	L Frt Door Moulding		0.4
28	100231	BDY	REMOVE/INSTALL	L Frt Otr Door Handle		0.3
29	101114	REF	REFINISH	L Quarter Panel Edge		C 0.5
30	101116	REF	REFINISH	L Add For Pillar		C 0.5
31	101118	REF	REFINISH	L Quarter Panel Inside		8.0
32	101057	BDY	REMOVE/REPLACE	L Quarter Outer Panel	Qual Recycled Part	450.00 * 18.5 #r
33	AUTO	REF	REFINISH	L Quarter Panel Outside		C 2.0
34	AUTO	MCH	REMOVE/REPLACE	L Add To R&I/R&R Side Curtain Air Bags-M		1.6 #
35	AUTO	MCH	REMOVE/REPLACE	L Rear Add To R&I/R&R Side Air Bag Senso		0,4
36	900500	BDY *	REPAIR	Trim LKQ Quarter	Existing	4.0*
37	101060	BDY	REMOVE/REPLACE	L Quarter Vent Grille	AG1Z 61280B62 A	20.35 * INC #
38	AUTO	BDY	REMOVE/INSTALL	Rear Bumper Cover		INC #
39	101078	BDY	REPAIR	L Quarter Inner Panel -S	Existing	5.0*
40		REF	REFINISH/REPAIR	L Quarter Inner Panel -S		1.5*
41	101086	BDY	REPAIR	L Inr Quarter Wheelhouse Panel -S	Existing	2.0*
42	101092	BDY	REMOVE/INSTALL	L Pillar Moulding		INC #
43	101094	BDY	REMOVE/REPLACE	L Quarter Wheel Opening Midg	FB5Z 7829165 AA	105.75 INC
44	101100	BDY	REMOVE/INSTALL	L Lwr Quarter Trim Panel		INC #
45	100701	BDY	REMOVE/INSTALL	L Rear Quarter Pillar Trim Panel	Existing	INC #r
46	101235	GLS	REMOVE/INSTALL	L Quarter Glass		1.6*#
47	101276	BDY	REMOVE/REPLACE	Qtr Glass Adhesive	N.A.	25.00 *
48	101367	MCH	OVERHAUL	L Rear Suspension One Side -M		5.2
49				DOES NOT INCLUDE ALIGNMENT		
50	101395	MCH	REMOVE/REPLACE	L Rear Susp Hub Assy -M	BB5Z 1104 A	185.98 INC #
51	101401	MCH	REMOVE/REPLACE	L Rear Susp Knuckle -M	DB5Z 5B759 B	479.80 INC #
52	101406	MCH	REMOVE/REPLACE	L Upr Rear Susp Control Arm -M	DE9Z 5500 B	184.05 INC #
53	101252	MCH	REMOVE/REPLACE	L Upr Rear Susp Arm Bushing -M	CB5Z 5A638 A	45.00 INC #
54	101258	MCH	REMOVE/REPLACE	L Upr Rear Susp Link -M	DB5Z 5A972 G	45.33 INC #
55	101267	MCH	REMOVE/REPLACE	L Rear Susp Shock Absorber -M	FB5Z 18125 E	74.04 INC #
56	101303	MCH	REMOVE/REPLACE	L Lwr Rear Susp Control Arm -M	8A8Z 5A649 C	258.07 INC #
57	101317	MCH	REMOVE/REPLACE	L Lwr Rear Susp Link -M	BB5Z 5500 A	93.36 INC #
58	101323	MCH	REMOVE/REPLACE	L Rear Susp Stabilizer Link -M	DG1Z 5K484 B	50.69 0.4 #
59	100601	BDY	REPAIR	L Rear Body Rail Extension -S	Existing	2.0*
60		REF	REFINISH/REPAIR	L Rear Body Rail Extension -S		0.5*
61	100631	BDY	REMOVE/INSTALL	L Rear Combination Lamp		INC #
62	AUTO	BDY	OVERHAUL	Rear Bumper Cover Assy		1.8 #
63	100669	BDY	REMOVE/REPLACE	Rear Upr Bumper Cover	Remanufactured	366.00 INC #
64	AUTO	REF	REFINISH	Rear Upr Bumper Cover		C 2.4
65	100671	BDY	REMOVE/REPLACE	L Rear Bumper Bracket	FB5Z 17D943 C	22.22 INC #
66	100673	BDY	REMOVE/REPLACE	L Rear Inr Bumper Bracket	FB5Z 17D943 A	35.47 INC #
67	100677	BDY	REMOVE/REPLACE	Rear Lwr Bumper Cover	FB5Z 17F828 A	342.27 INC #
68	100678	BDY	REMOVE/REPLACE	Rear Lwr Bumper Valance Panel	** QUAL REPL PART	141.50 * INC #
69	AUTO	REF	REFINISH	Rear Lwr Valance		C 1.2
70	100687	BDY	REMOVE/REPLACE	Rear Bumper Energy Absorber	** QUAL REPL PART	135.00 * INC #
71	936001		ADD'L COST	Towing	•	50.00 *
72	933035	FRM	ADD'L OPR	Unibody Pull		2,0*
73	900500	BDY *	REPAIR	Remove Door Graphics	Existing	4.0*
74	900500	BDY *	REMOVE/REPLACE	Replace Door Graphics	Sublet	437.50 * INC*
75	900500	MCH*	REPAIR	Test Reprogram Body Control Module Retest	Existing	3.0*
76				Test and Reset Air Bag System	=	
77	900500	MCH*	REMOVE/INSTALL	Front Emergency Lights and Wiring	Existing	2.0* r
78	933002	REF	ADD'L OPR	Clear Coat	<del>-</del>	2.0*
79	AUTO		ADD'L COST	Paint/Materials		622.80 *

Date: 10/22/2018 09:04 AM Estimate ID: 9458100019

Estimate Version: Committed

Profile ID: \* PDA TX Quote ID: 37757569

\* - Judgment Item

# - Labor Note Applies
\*\* QUAL REPL PART - Quality Replacement Parts

C - Included in Clear Coat Calc

r - CEG R&R Time Used For This Labor Operation

KEYSTONE-INS QUALITY PRT 4003 GREAT LAKES WY. DALLAS TX 75238 (972) 764-2272 (214) 348-3788

\*\* FO1095262 \*\* FO1114107R 63

167.00 366.00

Copyright (C) 1994 - 2018 Mitchell International

Software Version:

7.1.232

All Rights Reserved

Page 3 of 5

Date: 10/22/2018 09:04 AM 9458100019

Estimate ID: Estimate Version:

Committed

Profile ID: \* PDA TX Quote ID: 37757569

Recycler Information Section:

LKQ-Keystone-Burleson 2955 S I-35W Burleson TX 76028 972-225-1600 x3926;

32 2016 Ford

Explorer

LEFT QUARTER PANEL

VA

445.00

Part Number: T01177

Description:LH,WHT,4DR,W/OSUN,XLT L, (WHEEL LIP MOUL, L.,

Disclaimer: Recycled part pricing may represent either actual pricing (the price at which the recycler is willing to sell the part for in its existing condition) or undamaged pricing (the price at which the recycler would sell the part if it was in undamaged condition). If you are unsure, please contact the automotive recycler. Some parts located for this quote may be interchangeable but may not be an exact match. If you are unsure, please contact the automotive recycler.

Prior Damage:

Left front door dented.

#### **Estimate Totals**

i.	Labor Subtotals Body Refinish Glass Frame Mechanical	Units 48.3 17.3 1.6 2.5 12.6 Taxable L	Rate 46.00 46.00 46.00 46.00 85.00	Add'l Labor Amount 0.00 0.00 0.00 0.00 0.00	Sublet Amount 3.75 0.00 0.00 0.00 89.99	Totals  2,225.55 T 795.80 T 73.60 T 115.00 T 1,160.99 T 4,370.94	II.	Part Replacement Summary Taxable Parts Parts Adjustments Non-Taxable Parts Total Replacement Parts Amount	Amount 5,203.86 112.50 455.50 5,771.86							
	Labor Summary	82.3				4,370.94										
m.	Additional Costs Taxable Costs	;				Amount 622.80	IV.	Adjustments Insurance Deductible	Amount 0.00							
	Non-Taxable C	Non-Taxable Costs			Non-Taxable Costs		Non-Taxable Costs		Non-Taxable Costs		Non-Taxable Costs 50	50.00			<b>Customer Responsibility</b>	0.00
	Total Addition	nal Costs				672.80										
	Paint Material Method: Rates Init Rate = 36.00 , Init Max Hours = 99.9, Addl Rate = 0.00															
							I. II. III.	Total Labor: Total Replacement Parts: Total Additional Costs; Gross Total:	4,370.94 5,771.86 672.80 10,815.60							
							IV،	Total Adjustments: Net Total:	0,00 10,815.60							

ESTIMATE RECALL NUMBER: 10/22/2018 09:04:15 9458100019

Mitchell Data Version: OEM: OCT\_18\_V MAPP:OCT\_18\_V

Copyright (C) 1994 - 2018 Mitchell International

Page 4 of 5

Estimate ID:

Date: 10/22/2018 09:04 AM

9458100019

Estimate Version: Committed

Profile ID: \* PDA TX Quote ID: 37757569

THIS ESTIMATE HAS BEEN PREPARED BASED ON THE USE OF REPLACEMENT PARTS SUPPLIED BY A SOURCE OTHER THAN THE MANUFACTURER OF YOUR MOTOR VEHICLE. WARRANTIES APPLICABLE TO THESE REPLACEMENT PARTS ARE PROVIDED BY THE MANUFACTURER OR DISTRIBUTOR OF THESE PARTS RATHER THAN THE MANUFACTURER OF YOUR VEHICLE.

#### Point(s) of Impact

8 Left Rear Side (P), 6 Rear Center (S), 9 Left Side (S), 12 Front Center (S)

Insurance Co: TEXAS ASSOCIATION OF COUNTIES

Address: 1204 SAN ANTONIO

**AUSTIN, TX 78701** 

Inspection Site: Desk Review Inspection Date: 10/18/2018

> Body Shop: Lonestar Collision Address: 101 Maxie ST Cleburne, TX 76033

Telephone: (817) 558-4949 (817) 556-0919 Fax Phone: TIN 200563823

Email: leo@lonestar-collision.com

This is not an authorization for repair. All costs of repairs are the sole responsibility of the vehicle owner, who must authorize all repairs. Failure to deliver a copy of this appraisal to the repair shop by the vehicle owner may result in out of pocket expense to the vehicle owner. Providing a copy of this appraisal is not an acceptance of coverage or liability and all issues of coverage or liability are to be determined by the insurance carrier.

Deductibles may or may not be addressed or included in this appraisal. If applicable, the repairer should collect the deductible from the vehicle owner prior to the release of the repaired vehicle. It is the repairer's responsibility to send notification of the supplement via fax or email to PDA, including a statement whether the repairs have been halted on the vehicle. PDA will respond to your request within 24 hours. Please allow 48 hours to complete supplement processing from the date of request to ensure timely release of the vehicle.

This appraisal is subject to the complete review and approval by the assigning insurance company to assure accuracy, cost effectiveness, and that accepted industry repair standards are met. The insurance company listed has the right to accept or reject any part or all of . this appraisal or make any changes they feel necessary.

ESTIMATE RECALL NUMBER: 10/22/2018 09:04:15 9458100019

Mitchell Data Version: OEM: OCT\_18\_V

MAPP:OCT\_18\_V

Copyright (C) 1994 - 2018 Mitchell International All Rights Reserved

Software Version:

7.1.232