


Approved by CC:

FEB 10 2014


STATE OF TEXAS §

COUNTY OF JOHNSON §

BEFORE ME, Frances Box the undersigned
authority, on this day personally appeared Rick Bailey
known to me to be the person whose name is subscribed hereto, and having been duly
sworn by me on oath declared and stated that the attached copy of a Road Report, for
Precinct # 1 dated 2-10-2014 is true and correct.

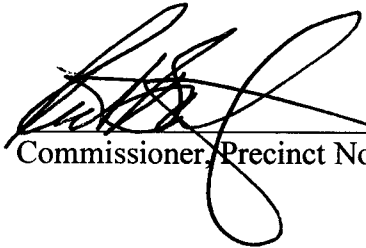
Commissioner, Precinct No. 1

SUBSCRIBED AND SWORN TO BEFORE ME this 10th day
of February, 2014, to certify which witness my hand and official seal.

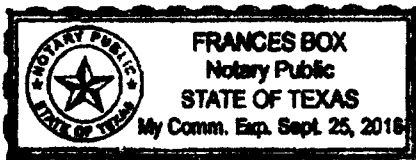

Frances Box
Notary for the State of Texas

COUNTY OF JOHNSON §
PRECINCT NO. 1 §

251.005 COMMISSIONER'S ANNUAL ROAD REPORT.

- 1. Condition of each road, culvert, and bridge in the precinct and the primary cause of any road, culvert or bridge degradation:
Overweight truck traffic is the primary cause of any degradation of our county roads, bridges and culverts.
- 2. Amount of money necessary for maintenance of the precinct roads during the next fiscal year \$895,370
- 3. Number of traffic control devices in the precinct defaced or torn down: 300
- 4. Any new road that should be opened in the precinct: None
- 5. Any bridges, culverts, or other improvements necessary to place the precinct roads in good condition, and the probable cost of the improvements:
detailed list attached; Probable cost of improvements - \$174,200

251.007 CLASSIFICATION OF COUNTY ROADS.

- A. All public roadways in Precinct One will be classified as third class roadways having less than 40 feet of roadway and some having less than 20 feet of roadway.

251.009 CATTLE GUARDS ON COUNTY ROADS.

- A. There are currently 17 cattle guards in Precinct One which the Precinct is required to maintain.

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION/NUMBER TO REPAIR/REPLACE	TxDOT BRIDGE ID#	FEATURE CROSSED	TxDOT SCORE, 11/28/2012 TxDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
305A	0.4	4		0							\$1,320.00	
				SH 171-1205 (1) 18" X 25" (2) 4" X 23" (1) 24" X 30" (1) 36" X 40"	3 3 3 3							
310	1.6	4		1206-SH 171: (1) 18" X 34" (1) 24" X 36" (1) 18" X 21" (1) 24" X 30" (1) 15" X 24"	3 3 3 3 3						\$5,280.00	
310A	2.2	3	TRUCK TRAFFIC	1018-1010: (1) 18" X 24" (04)	4	AA0155-001	MARTIN BRANCH	7/6			\$7,280.00	
902	2	3									\$6,500.00	
903	1.3	3-									\$4,290.00	
904	2.5	2		1010-1022: (2) 36"X35- Exbanda (08) (2) 42"X35 CULVERTS (08)	4 4						\$79,750.00	
904Z	0.535	2									\$1,765.50	
905	1.8	2	TRUCK TRAFFIC	0							\$21,486.00	
906	0.7	3		1008-1006: (3) 48" X 20" CULVERTS (1) 24" X 30" CULVERT	3 3						\$2,310.00	
907	1.4	3		1003A-1006: (3) 24" X 20" CULVERTS (1) 24" X 24" CULVERT (1) 18" X 24" CULVERT (2) 36" X 24" CULVERTS (3) 48" X 36" ARCH CULVERTS, (2) 36"X20" CULVERTS W/IRANDCONCRETE-REPLACE DIP (12)	4 4 4 4 4 4				2		\$4,620.00	
913	5	1006-1005 = 4 1005-1008 = 3									\$16,500.00	
1001	2	RR-171 = 2 171-913 = 4	TRUCK TRAFFIC	0							\$6,600.00	
1006	3.8	3		(1) 24" X 24" CULVERT (1) 24" X 24" CULVERT EXT (08)	3 3						\$12,540.00	
1008	1.7	4		0							\$5,610.00	
1009	2.7	3		1010-SH 171: (1) 24" X 30" CULVERT (1) 18" X 30" CULVERT (2) EXT (08)	3 4	AA1009-001	TRIB TO NOLAN RIVER	7/6			\$79,500.00	
1010	3.7	3		904-SH 171: (1) 36" X 24" CULVERT	3	AA0157-001	MARTIN BRANCH	7			\$12,210.00	
1010A	1.1	1	TRUCK TRAFFIC	(1) 18" X 24" CULVERT (1) 18" X 30" CULVERT	2 2						\$3,630.00	
1011	0.7	3		0							\$2,310.00	
1017	3	917-902 = 3	TRUCK TRAFFIC	(1) 18" X 24" BOX CULVERT (1) 30" X 30" BOX CULVERT	3 3				2		\$9,900.00	
1018	0.6	2	TRUCK TRAFFIC	(1) 48"X40" CULVERT (07) (1) 36"X32" CULVERT (08) (2) 15X20" CULVERTS (11)	3 4 4						\$1,980.00	
1022	1.9	3+									\$6,270.00	
1024Z	0.783			0							\$2,583.90	

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION NUMBER TO REPAIR/REPLACE	TXDOT BRIDGE ID#	FEATURE CROSSED	TXDOT SCORE 11/20/2012 TXDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR	
1100	1.5	4		SH 171-1200: (2) 36" X 22' CULVERT (1) 18" X 20' CONCRETE CULVERT (1) 7' X 4.8' CULVERT (1) 24' X 33' CULVERT (1) 18" X 26' CONCRETE CULVERT (1) 18" X 26' CULVERT	4 4 4 4 4 4						\$4,950.00		
1100A	1.3	3		HILL CO. 1203: (1) 36" X 30' CULVERT 1203-1204: (1) 18" X 21' CONCRETE CULVERT (1) 24" X 24' CONCRETE CULVERT	3 3 3						\$4,290.00		
1101	0.4	2		(1) 18" X 20' CONCRETE CULVERT (1) 36" X 30' CULVERT (11)	4 4						\$6,380.00		
1102	5.8	1206-1205=3+ 1205-1204=4 1204-1200=3+ 1200-171=3+		FM 2488-1206: (3) 6' X 12' X 32' BOX CULVERTS (1) 18" X 46' CULVERT 1206-1205: (1) 36" X 23' CULVERT (1) 12' X 53' CULVERT (3) 36" X 20' CULVERTS (1) 8' X 18" X 22' BOX CULVERT (2) 18" X 32' CONCRETE CULVERTS 1205-1204: (2) 36" X 29' CONCRETE CULVERTS (1) 24' X 42' CONCRETE CULVERTS (2) 36" X 20' CULVERTS (1) 24' X 30' CULVERT (2) CULVERTS 36" X 30' (13) 1203-1202: (1) 24' X 24' CULVERT (1) 36" X 30' CULVERT (1) 4' X 26' CULVERT (1) 36" X 27' CULVERT (1) 36" X 27' CULVERT 1200-KENNARD AVE: (1) 36" X 29' CONCRETE CULVERT (1) 5' X 24' CULVERT	3 3 3 4 4 4 4 4 4 5 3 3 3 3 3 4 4 4 4	740482-001 740482-002 740482-003	ALL 3- TRIB OF MUSTANG CREEK	368 366 367					\$16,172.00
1103	0.8	4		SH 171-END: (1) 15" X 26' CULVERT (2) 18" X 24' CONCRETE	3 4						\$2,640.00		
1103A	0.4	3		FM 916-END: (1) 24' X 18' CULVERT	3						\$1,320.00		
1103B	0.4	3		1102-1103: (1) 18" X 26' CULVERT (1) 24' X 28' CULVERT	3 3						\$1,320.00		
1104	0.7	4		1204-1205: (1) 18" X 46' CULVERT (2) 36" X 36' CULVERT (10)	3 3 3						\$2,310.00		
1104A	0.2	3									\$660.00		
1104B	0.3	3		(1) 18" X 32' CULVERT	3						\$390.00		
1104C	0.3	2+		1202: (3) 36" X 26' CULVERTS, (1) 24" X 30' CULVERT	3 3						\$390.00		
1105	2.3	4		SH 174-1206: (2) 24' X 28' CONCRETE CULVERTS (3) 24' X 42' CULVERTS (1) 18" X 37' CULVERT	4 4 4 4						\$7,590.00		

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT QUANTITY NUMBER TO REPAIR/REPLACE	TXDOT BRIDGE ID#	FEATURE CROSSED	TXDOT SCORE 11/24/2012 TXDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
1106	4.7	1224A-1223=2 1223-1222- 1221=3 1221-1208=4 1208-174=3		1224A-1223: (1) 5' X 21' CULVERT (1) 36" X 26' CULVERT 1223-1222: (1) 18" X 30' CULVERT (14) (1) 18" X 24' CONCRETE (1) 18" X 24' CONCRETE (2) 4' X 21' CULVERTS (2) 36" X 26' CULVERTS (2) 24" X 34' CULVERTS 1222-1221: (1) 4' X 26' CULVERT 1221-1208: 18" X 30' CULVERT 1208-SH 174: (1) 36" X 36' CULVERT (5) 36" X 26' CULVERTS (5) 18" X 26' CONCRETE	3 3 5 4 4 3 3 3 5	AA11-06-001 (BUILT 2012)	NOLAN RIVER	98			\$12,129.00	
1107	1.3	3+		(4) 36"x36" CULVERT - EXT (08) (2) 24"x24" CULVERT, Band (09)	4 4							
1107A	2.7	3		1205-1107B: (1) 24" X 27' CONCRETE (2) 36" X 18' (1) 24" X 36' (2) 36" X 24' (1) 15" X 21' CONCRETE (1) 24" X 30' 1107B-1202: (1) 24" X 20' CONCRETE (1) 15" X 36' CONCRETE 1202-SH 171: (1) 24" X 26' (08) (1) 9" X 24' (1) 18" X 32' CONCRETE	1 3 3 3 3 3 3 5 3 3							
1107B	1.3	3+		1205-1107A: (1) 24" X 24' (1) 18" X 30' (1) 5' X 24' (1) 36" X 18' (1) 24" X 21' CONCRETE (2) 36" X 28'	3 3 3 3 3 3							
1107C	0.1	3		0								
1108	4.6	3		FM 134A-1242: (1) 24" X 30' CULVERT (1) 24" X 32' CULVERT (1) 36" X 32' CULVERT (1) 24" X 30' CULVERT (1) 24" X 30' CULVERT (1) 36" X 30' CULVERT (1) 24" X 30' CULVERT (1) 36" X 42' CULVERT 1242-1117: (1) 24" X 37' CULVERT 1117-FM 916: (1) 18" X 24' CULVERT (1) 18" X 24' CULVERT (1) 18" X 32' CULVERT (1) 18" X 32' CULVERT (1) 24" X 32' CONCRETE CULVERT (2) 24" X 45' CONCRETE CULVERT (1) 17' X 30' TANKER CULVERT	3 3 3 3 3 3 3 3 3 4 4 4 4 3 3 3 3					2	\$20,340.00	

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR, 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION/NUMBER TO REPAIR/REPLACE	TXDOT BRIDGE ID#	FEATURE CROSSED	TXDOT SCORE 11/20/2012 TXDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
1109	1.9	1209-DE = 3 1209-1220 = 1 GRAVEL		1220-1109 (1) 24" X 24" CULVERT (1) 18" X 24" CULVERT (1) 36" X 24" CULVERT @ 1109 (11)	2 2 5				2			\$6,270.00
1109A	2.6	3		SH 174-1209: (1) 36" X 44" CULVERT (1) 18" X 32" CULVERT (1) 24" X 44" CULVERT (2) 24" X 36" CULVERTS (1) 4" X 10" BOX CULVERTS (2) 5" X 26" CULVERTS	3 3 3 3 5		NOLAN RIVER	97				\$8,580.00
1109B	1.7	3		FM 916-1109A (1) 18" X 26" CULVERT (1) 5" X 30" CULVERT (1) 18" X 26" CULVERT	3 3 3							\$5,610.00
1109C	0.2	4		(1) 18" X 26" CONCRETE	4							\$660.00
1109D	0.2	4		(1) 18" X 26" CONCRETE	4							\$660.00
1109E	0.2	4		(1) 18" X 26" CULVERT (1) 12" X 25" CONCRETE	4 4							\$660.00
1110	2.7	3-		1224-1224A 1) 18" X 26" CULVERT (1) 24" X 26" CULVERT (1) 30" X 26" CULVERT (2) 5" X 26" CULVERTS (1) 30" X 30" CULVERT (1) 36" X 26" CULVERT (1) 18" X 26" CULVERT	3 3 3 4 3 3 3							\$9,910.00
1110A	0.7	3+		(1) 24" X 32" CULVERT	4							\$2,310.00
1112	1.6	4		FM 1434-1219 (1) 18" X 24" CULVERT 1219-1218: (2) 4" X 24" CULVERTS (2) 48" X 30" CULVERTS (13)	5 4 5							\$5,280.00
1112 (OLD FOAM)	1.4	3		SH 174-1111: (3) 36" X 30" CULVERTS (1) 4" X 30" CULVERT (2) 4" X 21" CULVERTS (1) 36" X 32" CULVERT (2) 36" X 18" CULVERTS	3 3 3 3 3							\$4,620.00
1115	1	3		1225-1224 (1) 18" X 32" CULVERT (1) 18" X 26" CULVERT (1) 18" X 32" CULVERT (1) 18" X 21" CULVERT (1) 18" X 24" CULVERT	3 3 3 3 3							\$3,300.00
1116	1.2	3		0		BUILD-REPLACE LINC @ROBINSON CRK. US87					\$83,000.00	\$3,960.00

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT NUMBER TO REPAIR/REPLACE	TXDOT BRIDGE ID#	FEATURE CROSSED	TXDOT SCORE, 11/28/2012 TXDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR	
1120A (GCR)	1.6	3		HOOD CL-1120- (1) 18" X 32" CULVERT 1120-BND. (2) 36" X 26" CULVERTS (1) 4" X 26" CULVERT (1) 18" X 30" CULVERT (1) 18" X 30" CULVERT (1) 24" X 36" CULVERT	3 3 3 3 3							\$5,280.00	
1121	5.2	3	TRUCK TRAFFIC	FM 2331-1123 (1) 4" X 8" X 26" BOX CULVERT (1) 4" X 4" X 26" BOX CULVERT (1) 5" X 5" X 26" BOX CULVERT (1) 4" X 2" X 26" BOX CULVERT (1) 8" X 7" X 26" BOX CULVERT 1123-US 67 LOOP- (3) 4" X 8" X 26" BOX CULVERTS (1) 4" X 2" X 26" BOX CULVERT W/3' 12" X 26" CULVERTS ON TOP (2) 6" X 8" X 26" BOX CULVERTS	3 3 3 3 3 3 3 3	AA329-001 AA329-002 AA329-003	TOWN BRANCH TRIB OF LAKE PAT CLEBURNE NOLAN RIVER	6 6 7					\$17,160.00
1122	1.2	3		1121-1126 (1) 18" X 17" CULVERT (1) 15" X 24" CULVERT (1) 36" X 24" CULVERT (1) 18" X 24" CULVERT	3 3 3 3							\$3,960.00	
1123	5.1	3		FM 2331-WOODARD- (1) 36" X 27" CONCRETE (2) 36" X 25"-(1) CONCRETE, (1) STEEL (1) 18" X 26" CULVERT (1) 15" X 25" CONCRETE (1) DOUBLE CULVERT WITH (1) 36" X 25" & (1) 42" X 30" CULVERT (1) 24" X 28" CULVERT (1) 24" X 28" CULVERT (1) 15" X 25" CULVERT (1) 15" X 25" CULVERT (1) 18" X 26" CULVERT (1) 30" X 26" CULVERT (1) 12" X 30" CULVERT (1) 18" X 50" CULVERT (13) (1) 15" X 30" CULVERT (09)	3 3 3 3 3 3 3 3 3 3 3 5	AA1123-001	TOWN CREEK	7				\$16,830.00	
1124	3.3	5	TRUCK TRAFFIC	FM2331-FM 4 (1) 36" X 36" CULVERT (1) 24" X 26" CULVERT (1) 24" X 22" CULVERT (1) 18" X 21" CONCRETE (1) 18" X 24" CULVERT	5 5 5 5 5	AA1124-001	WEST FORK OF NOLAN RIVER	7				\$10,890.00	
1125	3.6	3		FM 4-1217- (1) 18" X 20" CULVERT (1) 18" X 20" CULVERT (1) 18" X 30" CULVERT (1) 36" X 24" CULVERT (1) 48" X 30" CULVERT FROM 1217 SH 171- (2) 60" X 46" CULVERTS (1) 18" X 52" CULVERT (09) (1) 36" X 20" CULVERT	3 3 3 3 3 3 3 3						\$11,880.00		
1125B	0.5	4		(1) 18" X 24" CULVERT	4							\$1,650.00	

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT NUMBER TO REPAIR/REPLACE	TxDOT BRIDGE ID#	FEATURE CROSSSED	TxDOT SCORE 11/28/2012 TxDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
1229	4.6	3		FM 2331-1128B: (2) 36" X 24" CULVERTS (1) 24" X 24" CULVERT (1) 30" X 25" CULVERT 1128B-1128A: (1) 36" X 30" CULVERT (1) 24" X 24" CULVERT (2) 42" X 20" CULVERTS (1) 24" X 24" CULVERT (1) 60" X 25" CULVERT 1128A-FM 4: (2) 30" X 30" CULVERTS (1) 24" X 30" CULVERT (1) 36" X 40" CULVERT (2) 30" X 24" CULVERTS	3 3 3 3 3 3 3 3 3 3 3						\$6,100.00	\$15,180.00
1229A	0.2	3		0								\$690.00
1230	3.8	1/2-4	TRUCK TRAFFIC	FM 2331-1127: (1) 60" X 24" CULVERT (1) 24" X 24" CULVERT (1) 24" X 24" CULVERT (1) 24" X 24" CULVERT 1127-FM 4: (1) 24" X 24" CULVERT (1) 18" X 24" CULVERT (1) 48" X 24" CULVERT (1) 24" X 24" CULVERT (1) 24" X 20" CULVERT	3 3 3 3 4 4 4 4 4							\$12,540.00
1231	0.8	2	TRUCK TRAFFIC	(1) 36" X 24" CULVERT	3							\$2,640.00
1231A	0.2	2	TRUCK TRAFFIC	0								\$660.00
1232	3.1	3	TRUCK TRAFFIC	1128-1127: (1) 18" X 30" CULVERT (2) 48" X 25" CULVERTS (1) 24" X 24" CULVERT (1) 48" X 24" CULVERT (1) 72" X 25" CULVERT 1127-FM 4: (1) 24" X 30" CULVERT	3 3 3 3 3 3 3							\$10,230.00
1233A	1.7	4		1233-FM 4: (1) 24" X 30" CULVERT (1) 18" X 30" CULVERT (1) 36" X 30" CULVERT	4 4 4							\$5,610.00
1234	3.5	3		1234 & 40850MERVL C.L-1118: (1) 24" X 32" CULVERT (1) 24" X 30" CULVERT (2) 36" X 40" CULVERTS (1) 18" X 25" CULVERTS (2) 36" X 32" CULVERTS (1) 24" X 36" CULVERT (1) 24" X 30" CULVERT	3 3 3 3 3 3 3							\$11,550.00
1234A	0.3	GRAVEL**		0								\$990.00
1235	1	2		FM 200-1236: (1) 24" X 42" CULVERT (1) 24" X 30" CULVERT (1) 18" X 48" CULVERT (00)	3 3 3							\$3,300.00
1235A	0.4	3		1236-FM 1434: (1) 18" X 25" CULVERT (00) (1) 18" X 60" CULVERT (00)	3 3							\$1,320.00
1235B	0.2	3		(1) 18" X 25" CULVERT	3							\$660.00

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION/NUMBER TO REPAIR/REPLACE	TxDOT BRIDGE ID#	FEATURE CROSSED	TxDOT SCORE, 11/20/2012 TxDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
1236	2.3	3-		FM 1434-1118: (3) 5' X 30' CULVERT (1) 36" X 36" CULVERT (2) 10' X 30' CULVERT (1) 24' X 36" CULVERT (1) 5' X 34' CULVERT (1) 6' X 32' CULVERT FM 1434-1117: (1) 18' X 36" CULVERT (2) 18' X 36" CULVERTS 1235A & 1236-1235: (2) 36" X 30" CULVERTS 1235 & 1236-FM 1434: (1) 18' X 36"	3 3 3 3 3 3 3							\$7,590.00
1237	2.7	1434-1118-3 200-C.L.=3										\$8,910.00
1238	1.6	2	TRUCK TRAFFIC									\$2,310.00
1239	0.9	4		FM 1434: (1) 15' X 30' CULVERT (1) 15' X 30' CULVERT (1) 15' X 30' CULVERT (1) 15' X 28' CULVERT (1) 18' X 30' CULVERT (1) 12' X 24' CULVERT	4 4 4 4 4 4							\$2,970.00
1240	1.9	4		1117 & 1240-1240A: (1) 24' X 24' CULVERT (1) 24' X 28' CULVERT (1) 36" X 28' CULVERT 1117B & 1240-1117: (1) 36" X 28' CULVERT (1) 24' X 30' CULVERT (1) 24' X 32' CULVERT	4 4 4 4 4 4							\$6,270.00
1240A	0.4	3		1240A & 1240: (1) 24' X 40' CONCRETE (1) 18' X 24' CONCRETE	3 3							\$1,320.00
1241	0.6	3		(1) 18' X 30' CULVERT	3							\$1,980.00
1242	1.1	4		1242 & 1108-1117A: (1) 24' X 36" CULVERT 1117A & 1242-1117: (1) 24' X 28' CULVERT (1) 24' X 36" CULVERT	4 4 4 4							\$3,630.00
1243	0.6	4		1243 & 1117-FM 1434: (2) 24' X 30' CULVERTS (1) 24' X 30' CULVERT	4 4							\$1,980.00
1250	0.8	1	TRUCK TRAFFIC	FM 1434-END: (2) 24' X 22' CULVERTS (1) 24' X 30' CULVERT (1) 18' X 22' CULVERT (1) 18' X 22' CULVERT	2 2 2 3			2				\$2,640.00
ALSTON CT	0.2	4										\$660.00
AMOS NORTH	0.3	3										\$990.00
ANDY NORTH	0.4	3										\$1,320.00
APACHE TRL	0.2	3										\$660.00
ARCHIE CT	0.4	4										\$1,320.00
APPLE CT	0.1	3-										\$330.00

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION/NUMBER TO REPAIR/REPLACE	TxDOT BRIDGE ID#	FEATURE CROSSED	TxDOT SCORE 11/28/2012 TxDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
ASCOT DR	0.8	3		12/19 NOLAN RV/RD: (1) 18" X 34" CULVERT (1) 24" X 55" CULVERT (1) 18" X 48" & (1) 24" X 48" DOUBLE CULVERT (1) 18" X 60" & (1) 24" X 60" DOUBLE CULVERT	3 3 3 3						\$2,640.00	
BAKER ST	0.3	2+		1101 OLA: (1) 18" X 28" CONCRETE (1) 18" X 28" CONCRETE (1) 18" X 22" CONCRETE (1) 18" X 20" CULVERT	3 3 3 3						\$990.00	
BENJAMIN BLVD	0.2	3									\$660.00	
BIRD SONG CT	0.2	4									\$660.00	
BLACKBURN DR	0.3	3									\$990.00	
BLACK FOREST TRL	0.5	3									\$700.00	
BOND RD	0.5	2	TRUCK TRAFFIC	(1) 18" X 30" CULVERT (04)	1 REPAIR LMC 3						\$2,900.00	\$1,650.00
BRUSHY NOB DR	0.3	3									\$990.00	
BRYANT PLACE	0.1	3									\$330.00	
CHEROKEE CT	0.1	3									\$330.00	
CHEROKEE TRL	0.4	3		(1) 24" X 25" CULVERT	3						\$1,320.00	\$330.00
CHEERY CT E	0.1	3									\$330.00	
CHEERY CT W	0.1	3									\$330.00	
CHEERY RIDGE CT	0.2	4									\$660.00	
CHEERY RIDGE LN	0.5	4									\$1,650.00	\$660.00
CIMMARON TRL	0.2	3									\$660.00	
COKE RD	0.1	3		BOND RD-WOODARD (1) 18" X 24" CULVERT (1) 18" X 28" CULVERT	3 3						\$330.00	\$2,970.00
COMANCHE DR	0.9	4									\$660.00	
CORRAL RD	0.2	4									\$660.00	
DAVIS CT	0.8	3+		1206-END: (3) 15" X 32" CULVERTS (1) 18" X 35" CULVERT (1) 30" X 36" CULVERT	3 3 3						\$2,640.00	
DUSTY TRL	0.4	3		SHINING STAR TRL-END (1) 12"x12" (1) 12"x20" CULVERTS W/BAND (11)	3 5						\$1,320.00	\$330.00
EAGLES NEST CT	0.1	3									\$330.00	
FOX CT	0.3	3									\$990.00	
FOX ST	0.3	4									\$990.00	
FOX RUN RD	0.6	3									\$1,980.00	
GOLD CUP DR	0.4	2		NOLAN RV/RD S. ST. LEGER (1) 18" X 48" CULVERT (3) 36" X 40" CULVERTS (2) 36" X 40" CULVERTS	3 3 3						\$6,380.00	\$1,980.00
HIGHLAND RD	0.6	3-									\$1,980.00	
HILL CT	0.5	3									\$1,650.00	

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION NUMBER TO REPAIR/REPLACE	TxDOT BRIDGE ID#	FEATURE CROSSED	TxDOT SCORE 11/28/2012 TxDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
NOLAN RIVER RD S (11111)	2.4	3		1218 CULVERTS: (1) 18" X 36" CULVERT (1) 36" X 28" CULVERT (1) 18" X 36" CULVERT (1) 24" X 34" CULVERT (1) 24" X 42" CULVERT	3 3 3 3 3	(1) 25' X 100' BRIDGE-1986 (LEVEL III)	A0877-001	6			\$7,920.00	
OLA AVE	0.1	2+									\$330.00	
OLD WAGON TRL	0.4	4		(1) 12' X 30" CULVERT	4						\$1,320.00	
OVERHILL DR	0.5	3		1121 RIVERVIEW DR (1) 18" X 36" CONCRETE (1) 4' X 30" CONCRETE (1) 15' X 36" CONCRETE (1) 15' X 48" CONCRETE	3 3 3 3						\$1,650.00	
PEACH LN	0.2	3									\$660.00	
PEAR CT	0.2	3									\$660.00	
PENNINGTON CROSSING	0.5	2 GRAVEL	TRUCK TRAFFIC								\$12,500.00	
PLUM COURTE	0.1	3									\$330.00	
PLUM COURT W	0.1	3									\$330.00	
PREAKNESS CT	0.14	3		(1) 24' X 42" CULVERT	3						\$462.00	
RESERVOIR RD	0.3	3									\$990.00	
RIVERVIEW DR	1	3		OVERHILL: (1) 15' X 42" CONCRETE OVERHILL-VALLEYVIEW (1) 15' X 36" CONCRETE LAKEVIEW-LAKEVIEW: (1) 24' X 36" CULVERT (1) 24' X 25" CONCRETE	3 3 3 3 3						\$3,300.00	
RUSTIC TRL	0.1	3									\$330.00	
SCENIC VIEW CT	0.1	3									\$330.00	
SHINING STAR TRL	0.3	3		MOUNTAIN VIEW-END: (1) 15' X 30" CULVERT (1) 24' X 25" CULVERT (1) 18' X 36" CULVERT (1) 12' X 30" CULVERT (1) 18' X 30" CULVERT	3 3 3 3 3						\$990.00	
SHOREVIEW DR	0.5	3-		1218-END: (1) 18" X 30" CULVERT (1) 18" X 21" CONCRETE (1) 12' X 23" CONCRETE	3 3 3						\$1,650.00	
SPUR CT	0.1	4									\$330.00	
ST LEGER DR	1.4	3		ASCOOT-GOLD CUP (2) 36" X 40" CULVERTS (2) 36" X 40" CULVERTS (1) 36" X 40" CULVERT	3 3 3						\$4,620.00	
THOMPSON AVE	0.1	2+									\$330.00	
THOUSAND OAKS DR	0.6	3									\$1,980.00	
TIMBER TOP TRL	0.5	3									\$1,650.00	
VALLEY VIEW TRL	0.5	3									\$1,650.00	
VALLEY VIEW LN	0.4	2									\$1,320.00	
VILLAGE DR	0.3	3									\$990.00	

ANNUAL ROAD REPORT
JOHNSON COUNTY PRECINCT 1

ROAD #	MILEAGE	CONDITION (1-5) 1=POOR, 5=EXCELLENT	CAUSE OF DEGRADATION	CULVERTS	CULVERT CONDITION/NUMBER TO REPAIR/REPLACE	TXDOT BRIDGE ID#	FEATURE CROSSED	TXDOT SCORE 11/26/2012 TXDOT INSPECTION	CONTROL DEVICES REPAIR/REPLACE	NEW ROADS NEEDED FOR OPENING	COST OF IMPROVEMENTS	USUAL COST OF MAINTENANCE IN COMING YEAR
WEST LAKE RD	0.5	3		US 87 END: (1) 24" X 48" CULVERT (2) 24" X 48" CULVERT (1) 24" X 48" CULVERT (3) 24" X 48" CULVERTS	3 3 3 3						\$1,650.00	
WILD OAKS AVE	0.4	3			0						\$1,320.00	
CUL-D-SAC E VALLEY VIEW LN	0.04	2			0						\$132.00	
CUL-D-SAC W VALLEY VIEW LN	0.04	2			0						\$132.00	
	263.738				0						\$174,200.00	\$1,090,720.40
BUDGET -IMPROVEMENTS /MAINTENANCE:											\$1,264,920.40	